



**Orphan Well
Association**

Notice No. 10

Orphan Well Association
Operations in City of Calgary

October 5, 2017

Lexin Orphan Operations 00/10-13-022-29W4/0

Tuesday, October 3, 2017 – The seals in the shear rams were replaced and the BOP's were stump tested to 35 MPa, prior to being installed on well. The Service Rig was inspected by the AER field inspector and the BOP's were function tested and the pressure test on well control equipment was completed. The heater string was pulled.

Wednesday, October 4, 2017 – Steamer was on location as the temperature dropped under 0°C. Slick-line has retrieved the downhole tubing plugs and the 73.0mm/60.3mm tubing string was pulled out of well. E-line was wheeled into location (to meet 90% road bans) and the equipment was set up and pressure tested.

Thursday, October 5, 2017 – The gauge ring trip was completed, the cement retainer was set and a cement bond log is being conducted on wireline.

PLANS - Conduct cement squeeze to abandon the sour zone, then apply to AER to reclassify well from critical sour and release H2S safety equipment. Plan to shut down over Thanksgiving weekend.

